

Operating Instructions

Type: MM-Xtruder
230 Volt / 115V

Serial number:
P.O. No.:
P.O. date:

Hand Extruder Ident Nos.:

230 V K03969A K04326A

115 V K04180A K04327A

 **These operating instructions contain important information to be observed for hand extruder operation and maintenance.**

It is therefore imperative that they be read and their contents fully understood by the operators before the hand extruder is placed in service.



Hand Extruder MM-Xtruder

Barnes

Plastic Welding Equipment Ltd.

Unit 11, Hamilton Street, Blackburn, Lancashire, BB2 4AJ

Tel: +44 (0) 1254 660910 Fax: +44 (0) 1254 660915

E-mail: info@plasticweldingequipment.co.uk

Website: www.plasticweldingequipment.co.uk

Scope of delivery:

Please check that the delivery is complete.

The delivery comprises:

1 hand extruder
1 extruder stand
1 welding shoe, machined
3 air nozzles

1 hot air hood
1 set of mounting tools
1 transport case

Contents

1	GENERAL	5
2	SAFETY	5
2.1	IDENTIFICATION OF INFORMATION IN THE OPERATING INSTRUCTIONS	6
2.2	PERSONNEL QUALIFICATION AND TRAINING	6
2.3	RISKS RESULTING FROM THE NON-OBSERVANCE OF THE SAFETY INSTRUCTIONS	6
2.4	SAFE WORKING PRACTICES	6
2.5	SAFETY INSTRUCTIONS FOR OPERATOR / OPERATING PERSONNEL	6
2.6	SAFETY INSTRUCTIONS FOR MAINTENANCE, INSPECTION AND MOUNTING	8
2.7	UNAUTHORIZED MODIFICATIONS AND SPARE PARTS	8
3	TRANSPORT AND STORAGE	9
3.1	TRANSPORT	9
3.2	STORAGE	9
3.3	RETURN TO MUNSCH	9
4	PRODUCT DESCRIPTION	10
4.1	APPLICATION RANGE	10
4.2	GENERAL DESCRIPTION	10
5	STARTUP AND SHUTOFF	11
5.1	GENERAL	11
5.2	PREPARATION	11
5.3	STARTING THE HAND EXTRUDER	12
5.4	WELDING WITH THE HAND EXTRUDER	13
5.4.1	<i>Introducing the welding rod</i>	13
5.4.2	<i>Replacement and aging of welding rod</i>	13
5.4.3	<i>Welding direction / rate</i>	14
5.4.4	<i>Work interruptions</i>	14
5.4.5	<i>Shutoff</i>	14
5.4.6	<i>Transport/Storage</i>	15
5.5	SET TEMPERATURES ON TEMPERATURE CONTROLLER	15
5.5	<i>Set temperatures</i>	15
6	MAINTENANCE / INSPECTION	18
6.1	MAINTENANCE / INSPECTION OF HAND EXTRUDER,	18
	TYPE MM-XTRUDER	18
6.2	DISMANTLING	18
6.2.1	<i>Hand extruder, type MM-Xtruder</i>	18
7	MALFUNCTIONS, CAUSES AND REMEDIES	22
7.1	TROUBLE-SHOOTING	22
7.2	FAULT DIAGNOSIS	22
8	TECHNICAL DATA	24

1 General



These operating instructions must always be available at the place of use of the hand extruder.

The objective of these operating instructions is to support operators in familiarizing themselves with the hand extruder and in using its functions for the intended service.

These operating instructions provide important information for the safe, workmanlike and economical operation of the hand extruder. Their observance helps avoid danger, minimize repair costs and downtimes, enhance reliability, and extend the service life of the hand extruder.

Any person performing work with/on the hand extruder is required to read the operating instructions. Such work includes, for instance:

- operation,
- maintenance, inspection and repair
- transport.

The hand extruder may only be mounted, operated and maintained by trained personnel.

In addition to the operating instructions and the national and local accident prevention regulations applicable at the place of use, the acknowledged technical rules for safe and proper working practices must be observed.

These operating instructions provide basic information to be observed for operation and maintenance. For this reason, it is imperative that they be read by the specialist personnel/Operator prior to placing the hand extruder in service and that they always be available at the place of use. Apart from the general safety instructions under section "Safety", also the special safety instructions given under the respective sub-sections must be adhered to.



Non-observance of the safety instructions may cause hazards to persons and the environment or damage to the hand extruder.

Moreover, failure to observe the safety instructions may lead to the forfeiture of any damages.

Non-observance of the safety instructions may in particular involve the following risks:

- failure of important hand extruder functions,
- hazards to persons due to electrical and mechanical impacts including risk of burns,
- hazards to the environment due to vapour-phase hazardous substances,
- risk of fire.

2 Safety

These operating instructions provide basic information to be observed for operation and maintenance. For this reason, it is imperative that they be read by the specialist personnel/Operator prior to placing the hand extruder in service and that they always be available at the place of use.

Safe operation of the hand extruder presupposes that the instructions under section 1 – General – of these operating instructions are complied with. In no case must the limit values indicated be violated.

Intact and unaltered hand extruders conform to the applicable codes and standards and meet all regulatory limit values regarding EMC (electromagnetic discharges and interference immunity). For the country-specific limit values to be observed, the Operator should consult the local electric utility. Nevertheless, the hand extruders emit electromagnetic fields within the acceptable limits. Electromagnetic fields may interfere with the operation of vital electronic devices (e.g. cardiac pacemakers). Persons wearing a cardiac pacemaker should therefore consult their physician before using the machine.

In addition to the operating instructions and the national and local accident prevention regulations applicable at the place of use, the acknowledged technical rules for safe and proper working practices must be observed.

Apart from the general safety instructions under section "Safety", also the special safety instructions given under the respective sub-sections must be adhered to.

Any working practices posing a safety risk are prohibited.

Hand Extruder MM-Xtruder

2.1 Identification of information in the operating instructions

In these operating instructions, safety instructions whose non-observance may cause hazards to persons are identified with



Hazard symbol according to DIN 4844 – W 9

for general hazards and with



Hazard symbol according to DIN 4844 – W 8

for electrical hazards.

Safety instructions whose non-observance may cause damage to the hand extruder and its functions are marked with

CAUTION

Instructions directly indicated on the hand extruder must be strictly followed and kept in a fully legible state.

2.2 Personnel qualification and training

The operating, maintenance and inspection personnel must possess appropriate qualification for the work to be performed. Functional and technical responsibilities and supervision of the operating personnel must be clearly regulated by the Operator. Where the personnel do not have the necessary skills and knowledge they must be trained and instructed (e.g. a DVS basic welder training in extrusion welding). A detailed instruction into hand extruder operation will be provided by the Manufacturer / Supplier on request. Furthermore, the Operator has to make sure that the contents of the operating instructions is fully understood by the operating personnel.

2.3 Risks resulting from the non-observance of the safety instructions

Non-observance of the safety instructions may cause hazards to persons and the environment or damage to the hand extruder. Moreover, failure to observe the safety instructions may lead to the forfeiture of any damages.

Non-observance of the safety instructions may in **particular** involve the following risks:

- failure of important hand extruder functions,
- hazards to persons due to electrical and mechanical impacts including risk of burns,
- hazards to the environment due to vapour-phase hazardous substances,
- risk of fire.

2.4 Safe working practices

The safety instructions given in these operating instructions, the applicable national accident prevention regulations and any existing in-company work instructions, operating and safety procedures issued by the Operator are to be followed.

2.5 Safety instructions for Operator / operating personnel

- Before placing the hand extruder in service, check the mains voltage and frequency against the data indicated on the type tag. The allowable tolerances are $\pm 5\%$ for voltage and /or $\pm 2\%$ for frequency.
- According to VDE 0100 §55, the hand extruder must be operated via a residual current-operated circuit breaker or an isolating transformer.
- **CAUTION** During hand extruder operation (under load), a voltage of not less than 230 V¹⁾ (115V)²⁾ must be available at the connector of the hand extruder.
- When using an extension cable, make sure to observe the minimum conductor cross-section. Use extension cables with protective conductor only.

Length [m]	Minimum cross-section [mm ²]
up to 19	4.0 ¹⁾
20-50	6.0 ¹⁾


1) for 230 V AC

2) for 115 V AC

- Extension cables must be certified for the specific service conditions (e.g. outdoor service) and identified accordingly.


Always handle the connecting cable with care.

- Do not kink the connecting cable.
- Do not place any objects on the cable.
- Do not jam or squeeze the connecting cable, nor pull it over sharp edges.
- Protect the connecting cable from moisture.

-  Do not touch the mains connector or connecting cable with wet hands. Hold the cable always at the connector when plugging or unplugging it.

- **CAUTION** Power generator sets used for power supply must be designed for the following rated output:


≥ 4 x rated output of hand extruder

-  Never allow the hand extruder to come into contact with water: Hazard to persons and equipment, short-circuit risk.

- **CAUTION** Never operate the hand extruder without air supply; risk of hand extruder damage.


When using an external air source, make sure that the air supply line is adequately dimensioned.

- **CAUTION** The supply air must be clean, dry and free from oil and water.

-  The hand extruder must not be used in explosion hazard areas or flammable atmospheres.


Make sure to stand on a firm base when operating the hand extruder.

The connecting cable, welding rod and hose for external air supply, if applicable, must be freely movable and must not obstruct the operator or third parties in their work.

-  Hold and touch the hand extruder only on the handles provided for this purpose.

- **Do not** touch bare metal parts (including hot air hood) either with or without gloves. These parts reach temperatures of up to 450 °C.
- Attachments may be damaged or impaired in their function if subjected to the full weight of the hand extruder.
- Bare metal parts must not come into contact with other items during the work or work breaks (e.g. cooling).

FIG. D02-0001

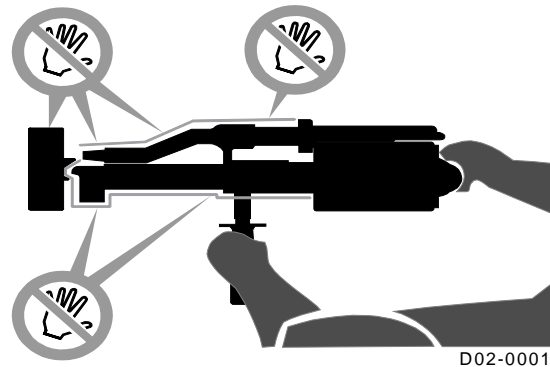

D02-0001


-  **Contact of combustible components with hot bare metal parts poses a risk of fire!**

Do not use synthetic gloves!

Hand Extruder MM-Xtruder

- Do not direct the hot air jet of the hand extruder towards living beings or temperature-sensitive items.

Safety distance: 2 m radius

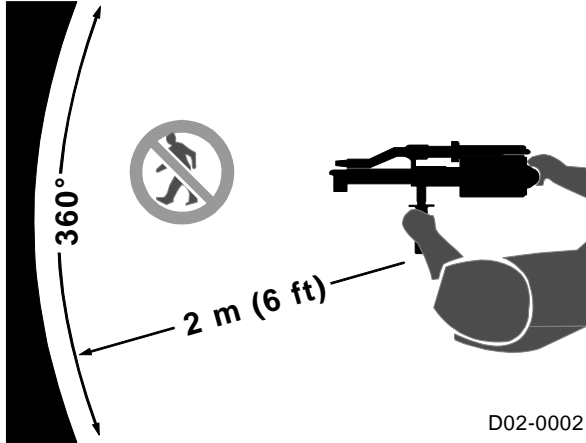

- Use suitable personal protection equipment for overhead work (e.g. hard hat, safety goggles, gloves, protective clothes ...) to guard against falling items.
- During work breaks and after completion of the welding job, place the hand extruder on the rests supplied for this purpose.



CAUTION The hot air hood must be remounted.



Make sure that the hand extruder is firmly positioned!

Deposit hand extruder in a dry location.

After completion of the welding job, cool the hand extruder to safe-to-touch temperature, using the air supply system.

-  Do not operate, dismantle or carry out modifications on the hand extruder, if
 - the connecting cable or the mains connector is defective,
 - safety devices are damaged,
 - foreign matter or liquid has penetrated into the hand extruder,
 - the unit does not work properly or there are unusual changes in the operating behaviour.
-  Never allow the hand extruder to come into contact with water: Hazard to persons and equipment, short-circuit risk.

2.6 Safety instructions for maintenance, inspection and mounting

The Operator is responsible for ensuring that maintenance, inspection and mounting activities are performed by authorized and **qualified personnel** who are thoroughly familiar with the operating instructions.

- As a rule, the hand extruder must be shut off and the connector unplugged before proceeding to any work on the unit. The shutoff procedure for the hand extruder described in the operating instructions must be strictly observed.
- Electrical hazards must be ruled out (for details, see VDE guidelines and the standards of your local electric utility, for instance).




- VDE 0701 (IEC 335) prescribes the measurement of the protective conductor resistance, insulation resistance and leakage current after each repair or modification to electrical equipment. Furthermore, a visual inspection of the unit and its connecting cable as well as voltage and current measurements and a function test must be carried out.
- Ensure the safe and environmentally compatible disposal of media, auxiliary materials and replaced parts!
- Remount and reactivate all safety and protective devices immediately on completion of the maintenance, inspection or repair work.


2.7 Unauthorized modifications and spare parts

Modifications or changes to the unit are only allowed after consultation with the Manufacturer. In the interest of safety, only original spare parts and accessories authorized by the Manufacturer should be used. The use of components other than the original spare parts may invalidate Manufacturer's liability for any resulting damage.

3 Transport and Storage


3.1 Transport

-  Before transport or storage, make sure that the hand extruder has cooled down to safe-to-touch temperature.

-  Hold and touch the hand extruder only on the handles provided for this purpose.

Do not touch bare metal parts (including the hot air hood) – whether with or without gloves – before having made sure that they are safe to touch. These parts reach temperatures of up to 450 °C during operation

FIG. D02-0001

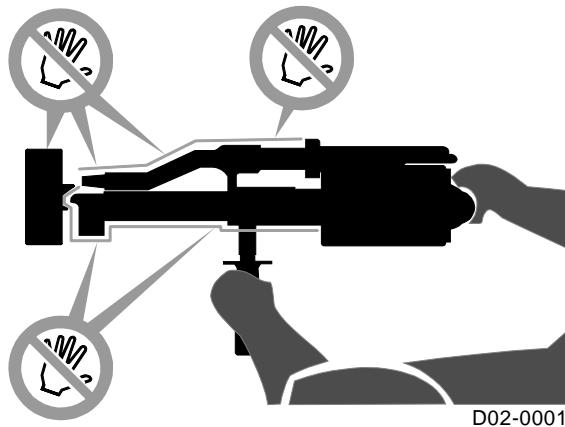

- Never transport or store the hand extruder in such a way that the attachments are exposed to mechanical loads.

If parts have been removed for transport purposes, mount and fasten them carefully before restarting the hand extruder!

Transport of the hand extruder in MUNSCH's original shipping case is recommended.

- For transport of the hand extruder, the transport case supplied together with the unit must be additionally packed using appropriate shock-proof packaging.

3.2 Storage

- Store the hand extruder in a dry and frost-free place.
- Protect the hand extruder from unauthorized access.
- Special preservation is not required.

3.3 Return to Munsch

Should it become necessary to return the hand extruder to MUNSCH Kunststoff-Schweißtechnik GmbH, always use the original shipping case.

For transport of the hand extruder, the transport case supplied together with the unit must be additionally packed using appropriate shock-proof packaging.

Hand Extruder MM-Xtruder

4 Product Description


4.1 Application range

The application range of the hand extruder is defined by the data on the type tag and the service limits indicated in these operating instructions.

CAUTION Operation of the hand extruder outside the application range stated in these operation instructions is subject to the Manufacturer's prior approval.

4.2 General description

The type **MM-Xtruder** is a hand extruder with integrated air supply (Autoair).

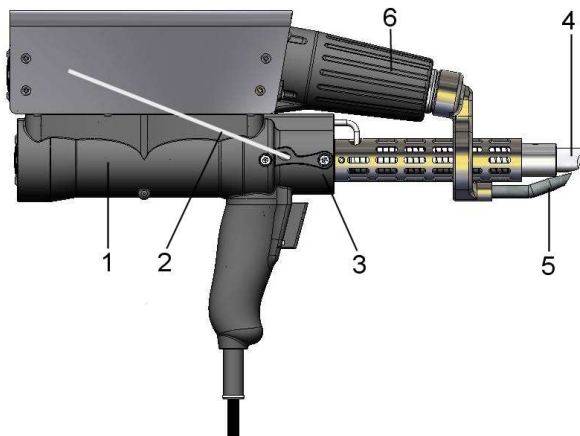

CAUTION!


Use 3 mm welding rod exclusively.

CAUTION Too low a speed will pose a risk of drive overheating!

Driven by a powerful electric motor (1), the welding rod (2) is fed into the extruder (3) and granulated by the extruder screw in the process. The screw forces the granulate into the extruder nozzle, melting it into a homogeneous, completely plastified mass. As the molten material exits the extruder nozzle, it is moulded by a welding shoe (4) to the geometry of the weld seam to be deposited

Preheating of the parts to be joined is achieved by a preheat nozzle (5) which is supplied from an on-board hot air unit (6). Air supply is via an on-board blower.

The melt and preheat air temperatures are controlled separately. The set point and momentary values are displayed concurrently.

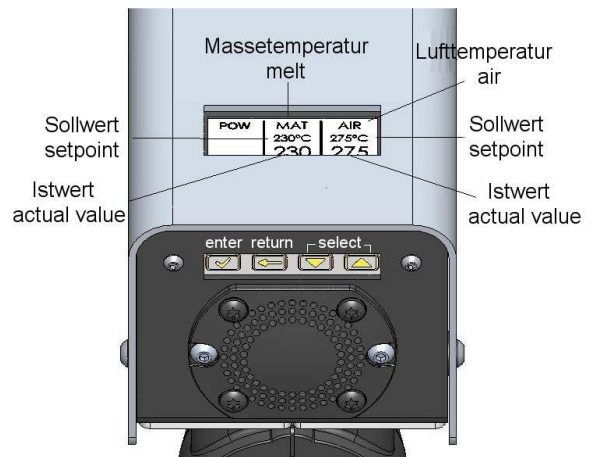

For the drive interlock to be released for starting, the melt and preheat air temperatures must be above the start interlock temperature and the startup timer must have timed out. The **start interlock temperature** and the **startup time** can be separately set for the melt and preheat air.

The temperature-controlled start interlock prevents the drive from starting if there is still unmolten material in the extruder, thus precluding damage to the unit.

The output rate is variable so that the preheat time can be matched to the weld thickness

5 Startup and Shutoff

5.1 General

In addition to the operating instructions and the national and local accident prevention regulations applicable at the place of use, the acknowledged technical rules for safe and proper working practices must be observed.

Any working practices posing a safety risk are prohibited.

Before starting / shutting off the hand extruder, make sure to carefully read the instructions under section "Safety".


Only trained and qualified personnel may be assigned to the operation of the hand extruder.

5.2 Preparation


- Place hand extruder with stand on a firm support.



- Mount hot air hood (128) to the heat guard (115) of the melting chamber.

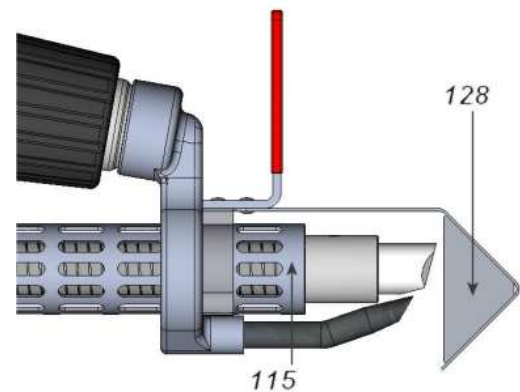


- Mount welding shoe
 - Select the welding shoe required for the specific weld geometry or machine a welding shoe blank to the required geometry.
 - Using the clamping ring (Item 1.1), mount welding shoe (Item 1) to the hand extruder in the position required for welding.
Observe welding direction!
Tighten set screw (25).
 - There are different welding shoe types. For their mounting, proceed in analogy with the above procedure.

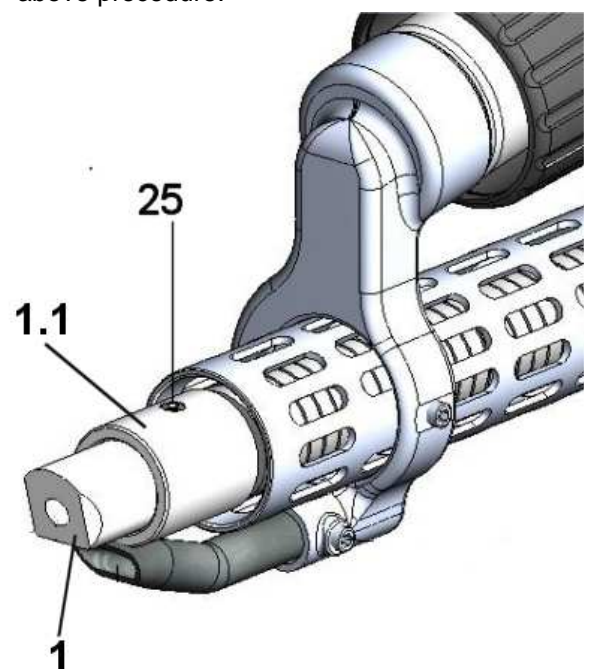

Hand Extruder MM-Xtruder

- Mount preheat nozzle
 - Select and mount the preheat nozzle (4) required for the specific weld geometry.
 - Observe spacing $A = 5 \text{ mm}$.
 - Tighten the preheat nozzle using the set screw (25.1).

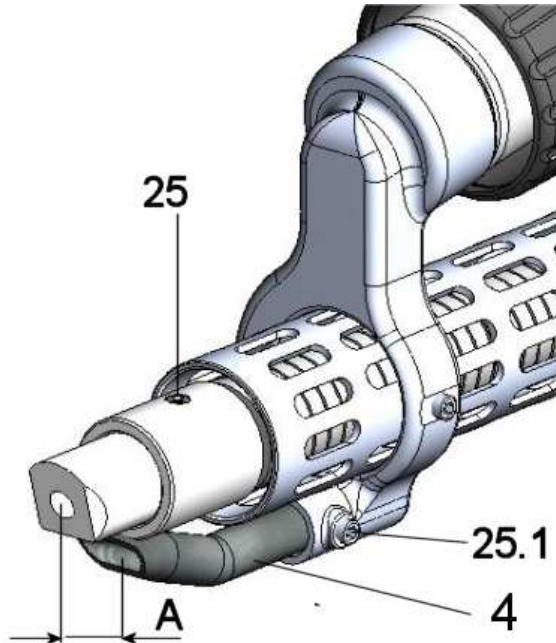

- **CAUTION** Before plugging in the mains connector, check that the drive unit is not set to continuous operation.
- **CAUTION** The hot air hood (128) must be mounted to the heat guard (115) of the hand extruder melting chamber.


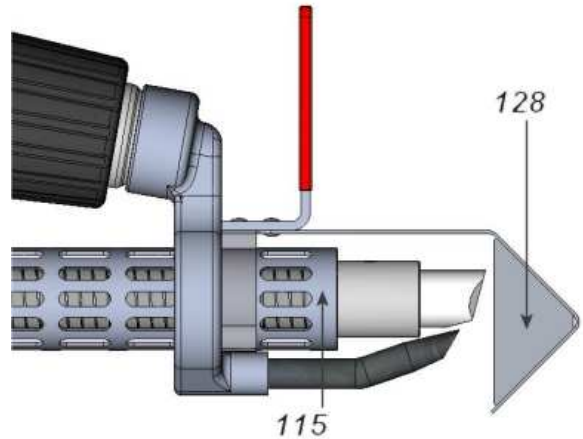


Table: Preheat nozzle (Item 4)

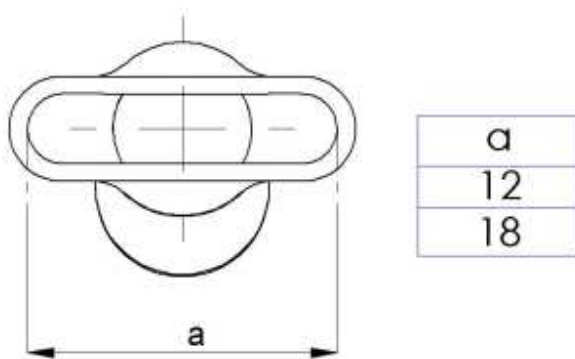

BA.EX008.10-00.Rev-00

Care must be taken to ensure that the preheat nozzle provides intensive and uniform preheating (melting) of the base material over the entire joint width at as low a hot air temperature as possible.


5.3 Starting the hand extruder



Observe section "Safety".

CAUTION Never operate the hand extruder without air supply. Otherwise the unit may suffer severe damage.

- **CAUTION** Plug in mains connector.
- **CAUTION** With the MM-Xtruder with integrated air supply, the on-board blower must start automatically.
- **CAUTION** Once air exits the preheat nozzle (4), the heating systems for the air/melt temperature may be activated.

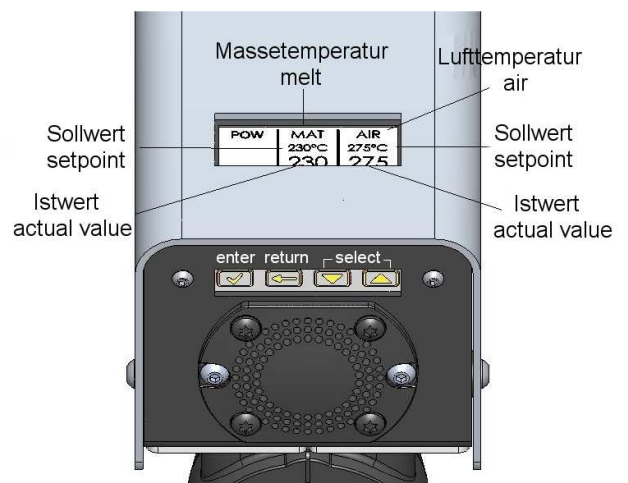

- For the operation of the temperature controller, see section 5.5 "Set temperatures". For the temperature settings, please see page 15, "Temperature chart for MM-Xtruder".

The hand extruder will reach its operating temperature after about 10 to 15 minutes.

- The drive speeds of the drive unit are set by default for the individual materials.


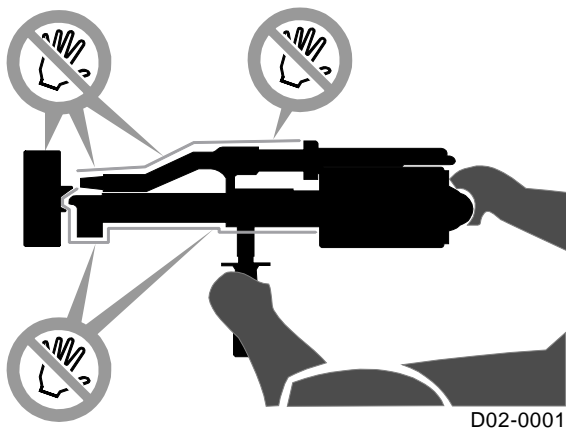
 Hold and touch the hand extruder only on the handles provided for this purpose.

FIG. D02-0001



D02-0001

- CAUTION** The Start switch of the drive unit may only be operated after the operating temperature has been reached and the startup timer has timed out. Otherwise, the hand extruder may be damaged by solidified material still present in the machine. The hand extruder is equipped with a start interlock which prevents starting of the drive before the melting temperature of the welding rod is reached. For temperature settings, see page 15 "Temperature chart for MM-Xtruder"

5.4 Welding with the hand extruder

 Observe section "Safety" and the data sheet.


General

Welding is to be carried out in accordance with the guidelines of the German Association for Welding Technology (Deutscher Verband für Schweißtechnik DVS).

The parts to be joined and the welding rod must be clean and dry.


5.4.1 Introducing the welding rod

- CAUTION** The hand extruder is provided with a bore **B** for introducing the welding rod.

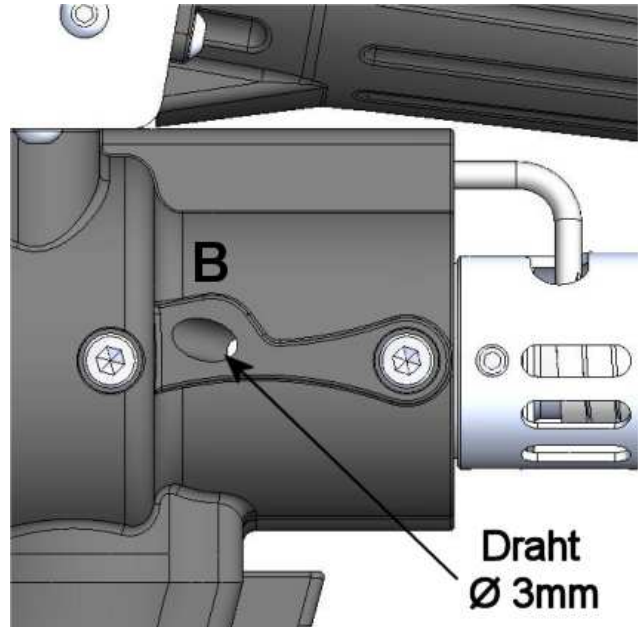

5.4.2 Replacement and aging of welding rod

- If the welding rod is to be replaced, make sure that any remaining rod in the hand extruder is completely removed.
- For this purpose, operate the preheated hand extruder with the new welding rod until clean new material discharges.
- The DVS guideline also recommends this procedure for hand extruders which have been out of service for prolonged periods while still being filled with welding rod.

-  Ensure safe and environmentally compatible disposal of any waste generated!